

Micro Mini Stress Ball Adapter

Installation instructions



PARTS LIST



FEED TUBE
(SHOWN WITH STRESS BALLS)



BALL LAUNCHER ADAPTER ASSEMBLY




(3) - 10-32 5/8
screw



(8) - 10-32 3/8
screw

STEP 1

! WARNING! - REMOVE THE CO2 TANK AND DE-GAS THE CANNON BEFORE ASSEMBLY.

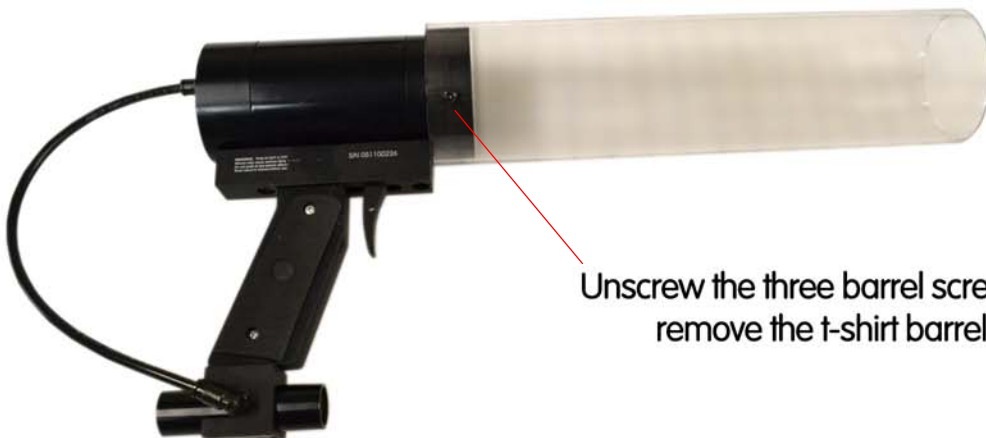

Unscrew the three barrel screws to remove the t-shirt barrel.

STEP 2

Unscrew the three screws to remove the t-shirt barrel adapter plate.



STEP 3

Place the stress ball adapter on as shown. Pay close attention to the hole alignment. Secure with the (3) provided 10-32 5/8" screws.



PAY CLOSE ATTENTION THAT THIS HOLE IS FACING 6'oCLOCK.

SHOWN ATTACHED



STEP 4

Slide the ball launcher adapter onto the adapter plate. Secure with (8) supplied 10-32 3/8 screws.



BEFORE

STEP 4 (Continued)



AFTER

STEP 5

Insert the feed tube into the saddle.



You are now ready to re-attach the CO2 tank, load the feed tube, gas the cannon and launch stress balls!